

Portalámpara con sensor de movimiento

Instructivo

LEA CUIDADOSAMENTE LAS SIGUIENTES INSTRUCCIONES DE USO ANTES DE INSTALAR


Este portalámparas cuenta con un sensor de movimiento de alta sensibilidad, que ofrece funcionamiento automático, seguridad, ahorro de energía y comodidad. Capta la radiación infrarroja emitida por las personas al entrar en la zona de activación y enciende la luz de forma inmediata. Detecta el día y la noche automáticamente, es fácil de instalar y adecuado para múltiples aplicaciones.

INSTALACIÓN

Corte la energía eléctrica antes de iniciar. Enrosque el sensor de movimiento en un portalámparas como se muestra en el diagrama. Conecte la lámpara al sensor y restaure la energía eléctrica para realizar la prueba descrita a continuación.

PRUEBA

1. Gire la perilla LUX en sentido horario hasta la posición máxima (☀).
Gire la perilla de TIEMPO en sentido antihorario hasta el mínimo.
2. Encienda la energía. El sensor se alimentará y se estabilizará en aproximadamente 30 segundos antes de entrar en modo de funcionamiento.
3. Tan pronto como la luz se apague por primera vez, active el sensor con movimiento; la lámpara deberá encenderse y permanecer encendida entre 5 segundos y 10 segundos.
4. Gire la perilla LUX en sentido antihorario al mínimo.
 - En condiciones de luz inferiores a 3 lux, la lámpara permanecerá apagada salvo que detecte movimiento.
 - Si se cubre la ventana de detección con un objeto opaco (p. ej., toalla), la luz se encenderá.
 - Sin señales de movimiento, la luz se apagará en 5 segundos-15 segundos.

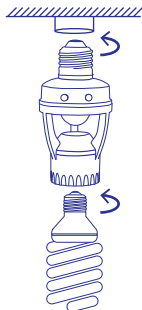

ESPECIFICACIONES

120 V~ 60 Hz 60 W (máx.)

Rango de detección:	0° - 360°
Distancia de detección:	hasta 6 m
Tiempo de retardo:	Mín. 8 s ± 3 s Máx. 5 min ± 1 min
Luz ambiente:	3 lux - 2 000 lux (ajustable)
Altura de instalación:	2 m a 3.5 m
Temperatura de operación:	-20 °C a 40 °C

NOTA: Para pruebas durante el día, coloque la perilla LUX en la posición máxima (☀) para permitir el funcionamiento del sensor.

⚠ ADVERTENCIA

Antes de instalar, interrumpa el paso de energía eléctrica para evitar daños materiales o lesiones. Este dispositivo está diseñado únicamente para lámparas. No se utilice con aparatos motorizados. Asegúrese de que el área de instalación esté seca antes de comenzar. Todas las conexiones eléctricas deben cumplir con la normativa local y ser realizadas por personal calificado.

Garantía. Duración: 1 año. Cobertura: piezas, componentes y mano de obra contra defectos de fabricación o funcionamiento, excepto si se usó en condiciones distintas a las normales; cuando no fue operado conforme instructivo; fue alterado o reparado por personal no autorizado por TRUPER®. Para hacer efectiva la garantía presente el producto, póliza sellada o factura o recibo o comprobante, en el establecimiento donde lo compró o en Corregidora 35, Centro, Cuauhtémoc, CDMX, 06060, donde también podrá adquirir partes, componentes, consumibles y accesorios. Incluye los gastos de transportación del producto que deriven de su cumplimiento de su red de servicio. Tel. 800-018-7873. Made in/Hecho in China. Importador TRUPER, S.A. de C.V. Parque Industrial 1, Parque Industrial Jilotepec, Jilotepec, Edo. de Méx. C.P. 54257, Tel. 761 782 9100. WWW.TRUPER.COM 08-2025

Sello del establecimiento comercial.
Fecha de entrega:



Motion sensor lamp holder

User manual

READ CAREFULLY THE FOLLOWING INSTRUCTIONS FOR USE BEFORE INSTALLING


This lamp holder features a high-sensitivity motion sensor, providing automatic operation, safety, energy savings, and convenience. It detects infrared radiation emitted by humans upon entering the detection zone and triggers the light immediately. The unit automatically detects day and night, is easy to install, and is suitable for a wide range of applications.

INSTALLATION

Turn off the power before starting. Screw the motion sensor into a lamp holder as shown in the diagram. Connect the lamp to the sensor and restore power to perform the test described below.

TESTING

1. Turn the LUX knob clockwise to its maximum position (☀). Turn the TIME knob counterclockwise to its minimum setting.
2. Switch the power ON. The sensor will power up and warm up for approximately 30 seconds before entering operating mode.
3. Once the light turns off for the first time, trigger the sensor by movement; the lamp should turn on and remain lit for 5 seconds to 10 seconds.
4. Turn the LUX knob counterclockwise to the minimum.
 - In lighting conditions below 3 lux, the lamp will remain off unless it detects motion.
 - The light will turn on if the detection window is covered with an opaque object (e.g., a towel).
 - Without motion signals, the light will turn off within 5 seconds-15 seconds.

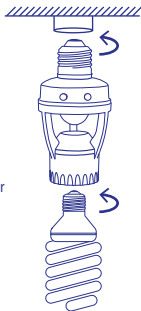

SPECIFICATIONS

120 V~ 60 Hz 60 W (max.)

Detection range:	0° - 360°
Detection distance:	up to 19.7 ft (6 m)
Time delay:	Min. 8 s ± 3 s Max. 5 min ± 1 min
Ambient light:	3 - 2 000 lux (adjustable)
Installation height:	6.6-11.5 ft (2 to 3.5 m)
Operating temperature:	-4 °F to 104 °F (-20 °C to 40 °C)

NOTE: When testing during daylight, set the LUX knob to the maximum (☀) position to allow the sensor to operate.

⚠ WARNING

Before installing, disconnect the power supply to prevent property damage or injury. This device is designed only for lighting control. Do not use it with motor-operated appliances. Ensure the installation area is free from moisture before starting. All electrical connections must be made in accordance with local codes and by qualified personnel.

Warranty. Duration: 1 year. Coverage: parts, components and workmanship against manufacturing or operating defects, except if used under conditions other than normal; when it was not operated in accordance with the instructive; was altered or repaired by personnel not authorized by TRUPER®. To make the warranty valid, present the product, stamped policy or invoice or receipt or voucher, in the establishment where you bought it or in Corregidora 35, Centro, Cuauhtémoc, CDMX, 06060, where you can also purchase parts, components, consumables and accessories. It includes the costs of transportation of the product that derive from its fulfillment of its service network.

Phone number 800-018-7873. Made in China. Imported by TRUPER, S.A. de C.V. Parque Industrial 1, Parque Industrial Jilotepec, Jilotepec, Edo. de Méx. C.P. 54257, Phone number 761 782 9100. WWW.TRUPER.COM 08-2025

Stamp of the business.
Delivery date:

